

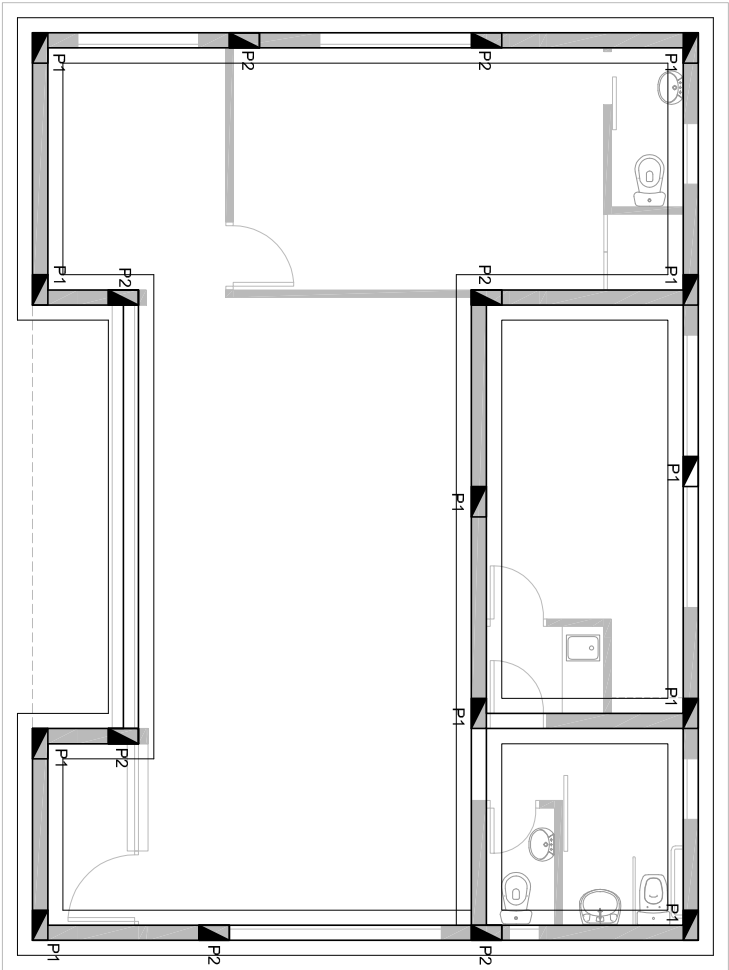


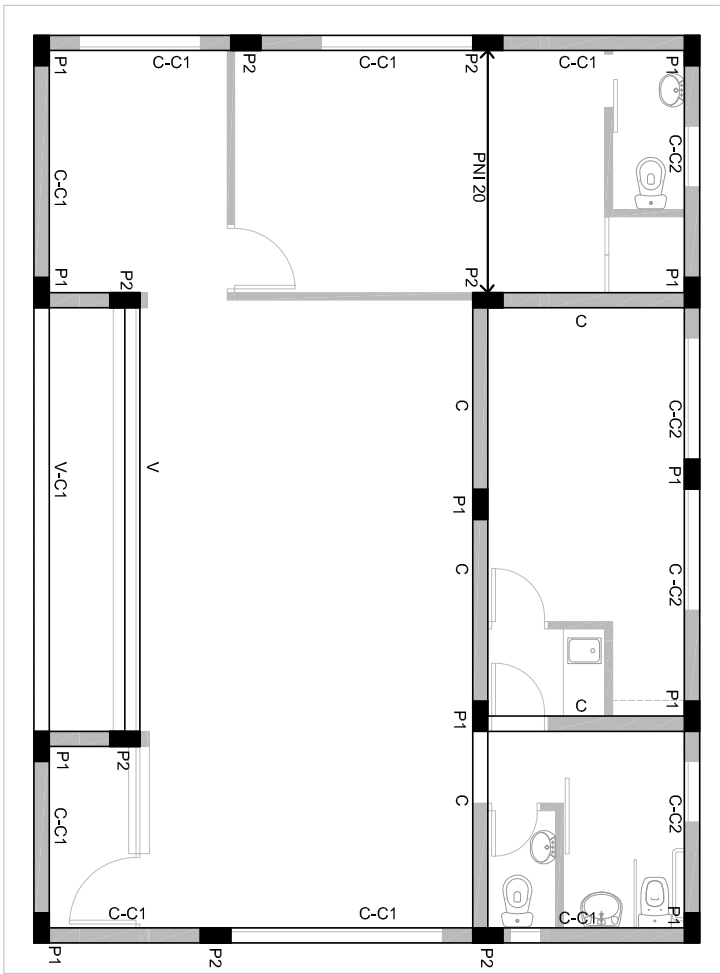

CIMENTACION

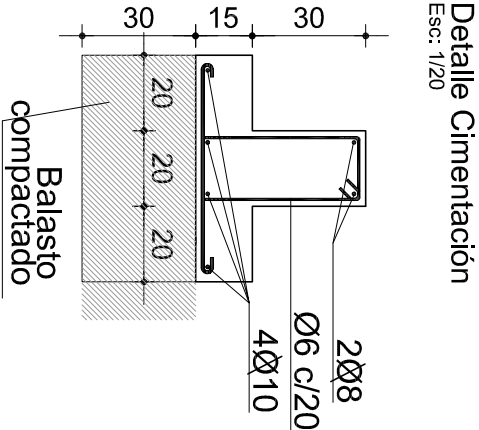

INDICE 100

| PLANILLA DE VIGAS |    |         |     |       |         |       |
|-------------------|----|---------|-----|-------|---------|-------|
| b X h             | Nº | Ø A     | Ø B | Ø E   | estf.   | FONDO |
| 20 X 40           | C  | 2 Ø 8   |     | 2 Ø 8 | Ø6 C/20 | 2.10  |
| 20 X 20           | C1 | 2 Ø 8   |     | 2 Ø 8 | Ø6 C/20 | 3.30  |
| 20 X 20           | C2 | 2 Ø 8   |     | 2 Ø 8 | Ø6 C/20 | 2.50  |
| 20 X 60           | V1 | 2 Ø X10 |     | 2 Ø 8 | Ø6 C/15 | 2.10  |
| 20 X 20           | V2 | 2 Ø 8   |     | 2 Ø 8 | Ø6 C/20 | 3.10  |

PILARES: P1: 40 X20 - 4Ø8 - ESTR. Ø6 C/20  
P2: 20 X40 - 4Ø8 - ESTR. Ø6 C/20

OBRA:

JUNTA DE CENTENARIO

|            |                     |                        |
|------------|---------------------|------------------------|
| LAMINA:    | DIRECTOR:           |                        |
| Estructura | Ing. Raul MONTERO   |                        |
| LOCALIDAD: | TÉCNICO:            |                        |
| Centenario | Arq. Ana Laura BAEZ |                        |
| Nº PADRÓN: | MANZANA:            | SALA DE DIBUJO:        |
|            |                     | Dib. Tec. Javier SAINZ |
| ESCALA/S:  | FECHA:              |                        |
| 1:100      | Noviembre 2016      |                        |